# HDP-D90

## Sound Manager & Firmware Update

**Update resolves:**
Area Control Detection issue. (Internet connection always required when connecting to DSP Amplifier). This is an issue in areas where internet is not always available.

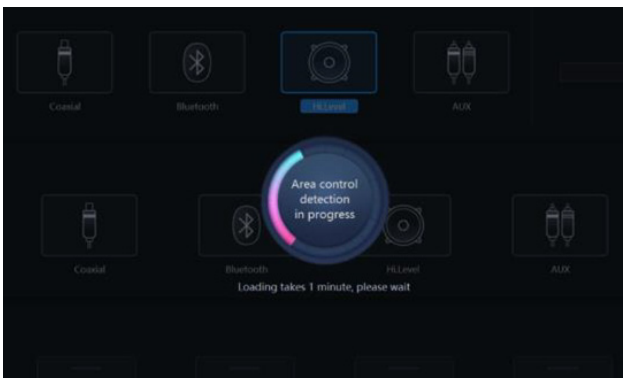


Visit alpine.com.au/support/product-software-updates for more information

# HDP-D90

## Sound Manager & Firmware Update

**Please note:** Your PC must be connected to the internet before opening the Alpine Sound Manager application. After the firmware update has been completed - your DSP will no longer require an internet connection when - connecting via Alpine Sound Manager.

**1.** Download files from alpine.com.au

- Alpine Sound Manager Application (HDP-D90_Windows_Software_KV3.02 250415)
- PXE-M60-4 Firmware (HDP-D90-MCUUpdateVA.00-250415.bin)

**2.** Unzip Windows Software and open Application.

**3.** Data Processing (shown below): Area control passed validation.

**4.** Connect USB cable from PC to DSP Device.

**5.** Check SW & Device Version (Select Option > About). *(PXE-M60-4 Example Shown)*

**6.** Go to Option > Firmware Update.

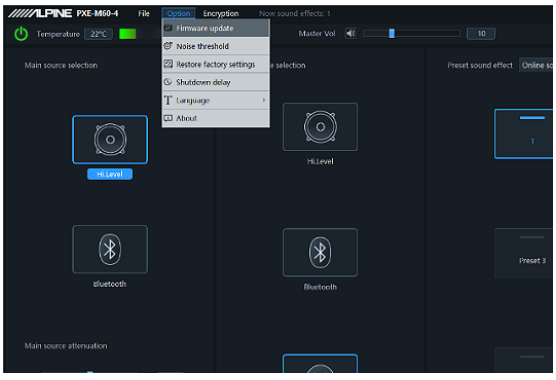


Visit [alpine.com.au/support/product-software-updates](alpine.com.au/support/product-software-updates) for more information

# HDP-D90

## Sound Manager & Firmware Update

**7.** Select the .BIN file (Firmware Package for your DSP). *(PXE-M60-4 Example Shown)*

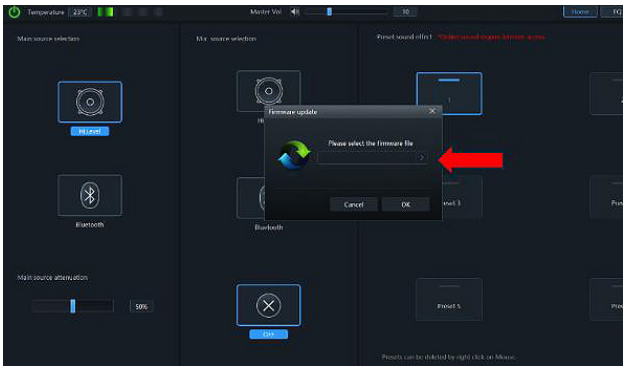

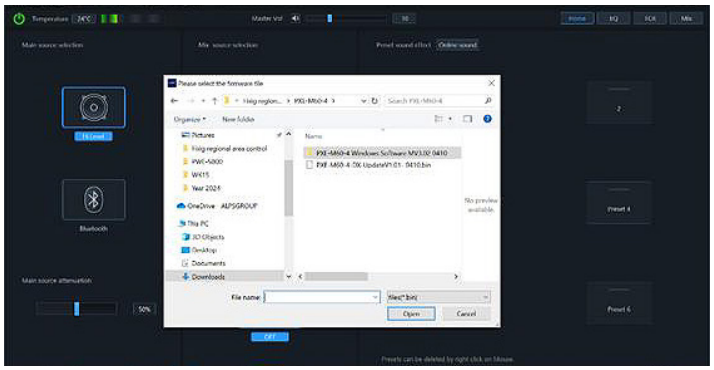

**8.** Click OK to start the update. **Important!** Do Not Power Off Unit During Update.

**9.** When update is 100% complete > Check device version. *(PXE-M60-4 Example Shown)*

**10. Update complete.** Use Sound Manager V3.1 to connect to the DSP Amplifier and tune accordingly.